



SUBJECT

Missing Clip on Power Cable Causes Various Electrical Complaints

MODEL

E70 (X5) produced up to March 25, 2007


SITUATION

There are a variety of possible complaints:

- Vehicle will not start
- Instrument Cluster or displays are flickering
- Remote Control will not unlock vehicle
- Various control modules cannot be accessed using the diagnosis system
- Various other issues relating to the power supply

Possible fault codes include A6E2, A734, 93C6 and 9CB5.

CAUSE

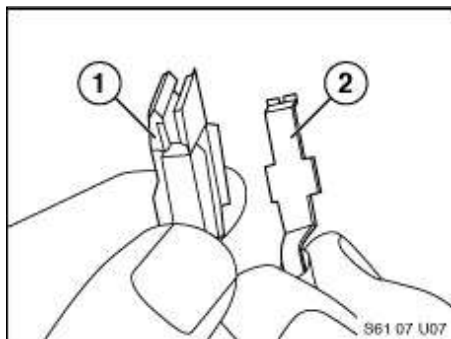

The clip (1) on the power supply terminal (2) (X16825 in the rear power distribution box, or X16824 in the front JBE [Junction Box Electronics]), is either loose or missing

CORRECTION

In case of customer complaint, check the following terminals:

