



This Service Information bulletin supersedes SI B66 09 09 **dated June 2009**.

NEW designates changes to this revision

SUBJECT

Failure of Remote Control Locking

MODEL

E70 (X5)

Situation

Intermittently or permanently, the remote control locking is inoperative. Both remote keys are affected. **NEW** In some cases, the parking brake warning is illuminated in the instrument cluster and fuse F129 is blown.

cause

Wiring harness damage to the electrical components in the rear hatch, in the area where they pass through the body and rubber harness

correction

Please refer to the attachment.

PARTS INFORMATION

Part Number	Description	Quantity
61 13 6 908 716	Felt tape**	
NEW 61 13 6 917 401	5A fuse	1 (if necessary)
Locally sourced	Electrical tape**	

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty.

Defect Code: **61 11 01 79 00**

Labor Operation:	Labor Allowance:	Description:
51 43 259*	Refer to KSD	Removing and installing trim panel for roof pillar (D-pillar)

*Main Work - use this labor operation number when this is the only repair being performed, or if this is the main repair when performed along with other repairs at the same time. If this is not the main repair, refer to KSD for the associated (+) labor operation code.

NEW Only 1 of the following may be claimed:

NEW Repair 1

61 99 000 WT Repair RT/SW wire, apply edge protection and replace fuse 129

NEW Repair 2

61 99 000 1 FRU Reinsulate BL/RT wire and apply edge protection

Sublet		** Reimbursement of up to the amount listed may be charged to sublet code 4 for
Code	\$1.00	the Felt Tape (P/N 61 13 6 908 716) and electrical tape required to perform this
4**		repair. Claiming this part number outside of sublet code 4 will result in a delayed
		or denied claim payment.

Attachments

View PDF attachment [B660909Attachment](#).

[Copyright ©2009 BMW of North America, Inc.]